

# Manhole Inspection Summary

Manhole # S33II1022MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **33II1** Node: **022** Status: **Found**

Insp Date: **3/27/07 9:53 AM**

Incomplete Comments

Crew: **WM, BC**  
Inspector: **Morris, W**  
Firm: **RKK**

**Location** Address: **CHARLES ST**

Cross Street: **STRATFORD RD**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **12** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel**

Material: **Brick and Concrete** ☐ Parged

Shape: **D-Shape**

Diameter: **72** (in.) Length: **72** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **1** nearest .5 ft. Azimuth: **223**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **10** Missing: **0** ☐ Corroded

**Surcharge**

☒ **Evidence Of Surcharge** Depth: **5** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S33II1022MH

Printed On: 12/17/2008

Page 2 of 4

Location View




Top View



Corroded steps. Bench debris.

2 INCH PIPE

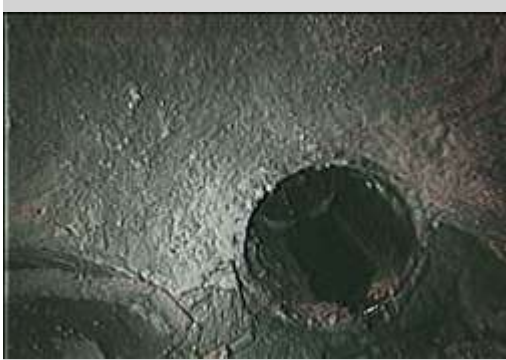

Defect



Frame leaks. Adjustment loose brick, deterioration and infiltration. Corbel infiltration.

## Manhole Inspection Summary

Manhole # S33II1022MH

Printed On: 12/17/2008

Page 3 of 4

### 12 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **18.53** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 6 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.78** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

### Drop In @ 3 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **16.51** (ft.)

Inv Depth: **17.51** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S33II1022MH

Printed On: 12/17/2008

Page 4 of 4

### 12 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **18.28** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer

Drop In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **18.03** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection